



Topic: Thermal cut-out update		TB No.: TB10057	Date: 10/06/2022
Affected Machines:	All Eco boiler/ Ecosmart range	Priority: Low	Created By: Eddie Purtil
From Serial No.:	>03/20	Created For:	Technicians
From Date:	March 2020	Pages: 1/1	


UPDATE

A new Double pole overheat is being fitted to Eco boiler after serial no 0320XXXX.


***** The two versions of overheats will not be interchangeable. *** Must exchange like for like!**

NOTES FOR ENGINEERS

The new overheat (1502075) will be fitted to the incoming live and neutral of the flex and when it trips it will cut the power to the boiler, not just the element like the older version (1502087). This will mean that when it trips all the lights on display will go out and the error for not heating (4 flashes) will not be displayed.

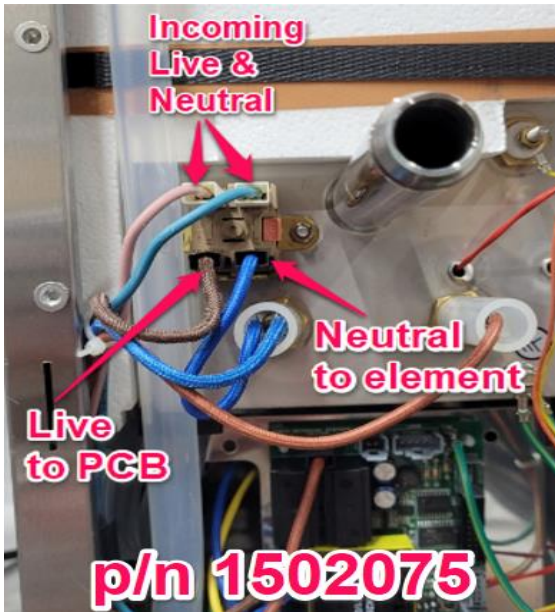

PART CODES

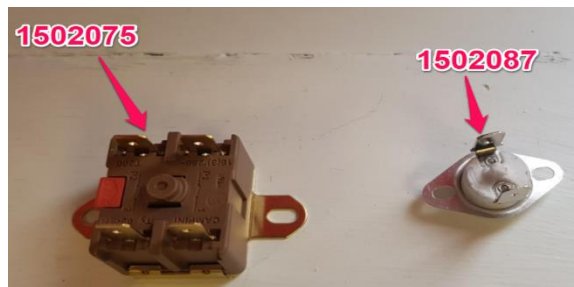

Thermal Switch Dual Pole 125deg part no 1502075

Thermal Switch 130 deg part no 1502087.