



TB10055

<b>Topic:</b>		<b>TB No.:</b> 10055	<b>Date:</b> 14/01/2021
<b>Affected Machines:</b>	Ecoboiler PB5/PB10	<b>Priority:</b> Low	<b>Created By:</b> Eddie Purtil
<b>From Serial No.:</b>	All	<b>Created For:</b> Technicians	
<b>From Date:</b>		<b>Pages:</b> <u>2</u>	

### ***Solenoid 1502148 stem resize.***

#### UPDATE


*In order to reduce parts Marco adopted one valve for both Ecoboiler and Ecosmart(LED screen) push button models.*

The dispense valve p/n 1502148 inlet stem must be cut to fit the **Ecoboiler Push Button range**. Please see below image.

**Ecosmart PB does not need to be cut.**

#### NOTES FOR ENGINEERS

Measure 17mm as below

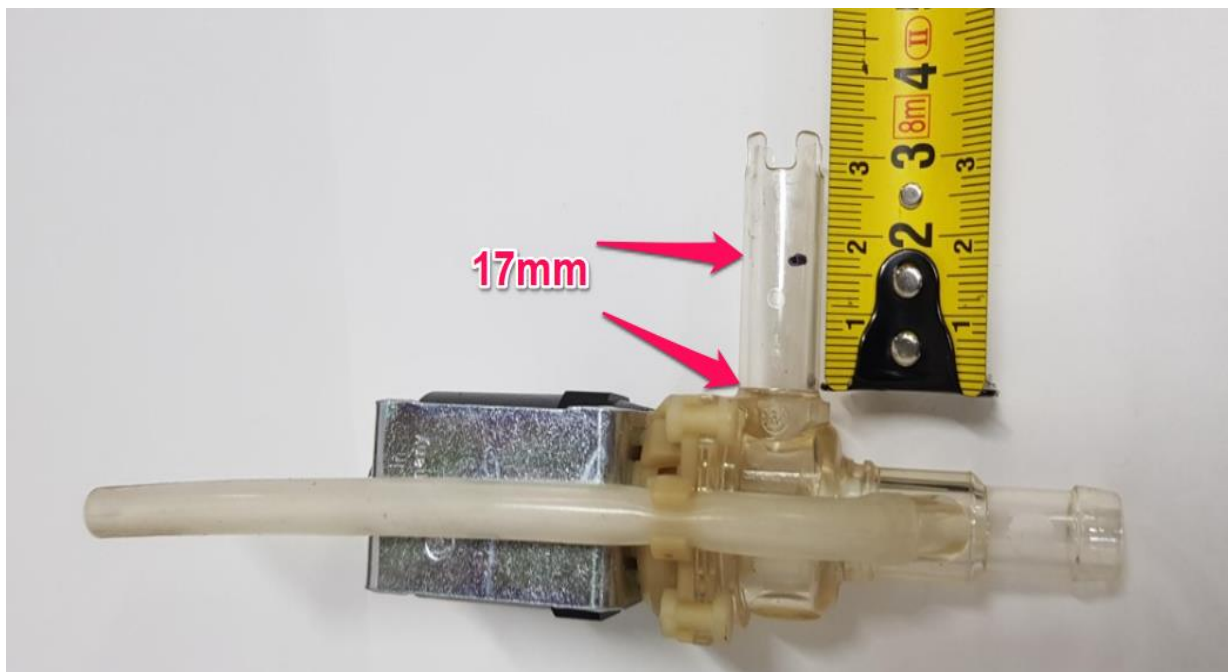




## TB10055

Cut the valve stem using a pipe cutter as shown. Please note a hacksaw shouldn't be used as swarf could get into the valve and cause it to jam open.

*If you do not have a pipe cutter, and you must use a hacksaw, place a tissue into the valve to prevent any plastic swarf from entering the valve and wash out after cutting!*

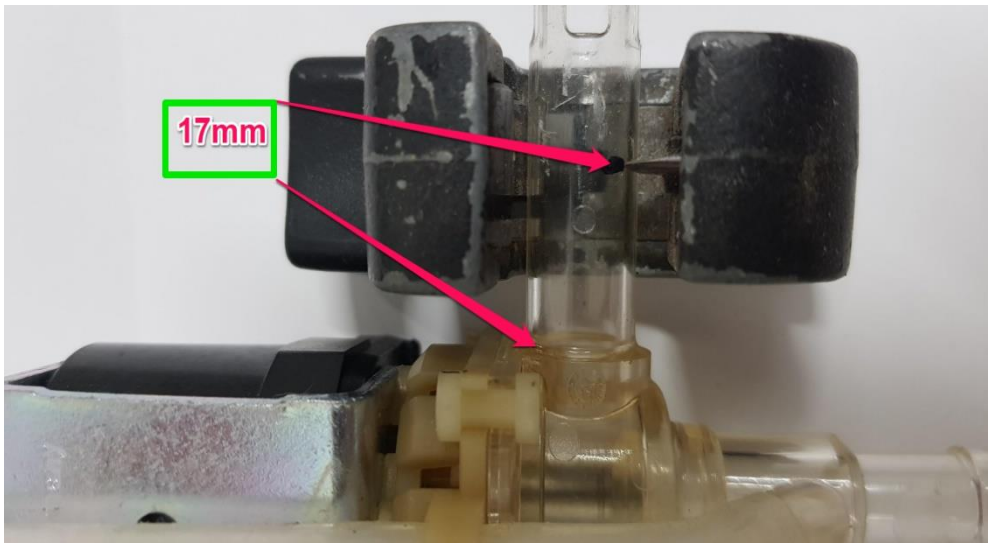

Ready for use